Mess- & Feinwerktechnik GmbH



MFE 900 Long travel extensometer

Area of application

The MFE extensioneter is specifically designed for applications with highly lengthening materials such as plastics and rubber, incorporating long travel (up to 900 mm).

Design and function

The MFE is used on semi- and fully automated testing machines, preferably in applications where the gauge length does not have to be changed often.

The MFE works semi-automatically, the positioning of the measuring arms on the samples mid-point and the setting of the measuring length is done manually (once at the beginning of the test). The attachment and detachment of the measuring arms and the move to the previously set sample centre or initial measuring length is then operated automatically (by electric motor). As long as the initial measuring length and the position of the samples remains unchanged, no further manual operation takes place on the device. Only when the measuring length is to be changed a manual operation has to be carried out again.

The MFE is suitable for almost all samples (from gauge length of 10 mm) and under ideal conditions for measurements up to specimens fracture.

The measuring direction can be chosen between upwards or downwards. The measuring arms can be easily and quickly removed from the device by means of a plug-in screw system.

Controlling

The MFE is controlled by two potentialfree contacts, which switch up to 15 mA (at 24 V DC). Following 3 options could be used.

- 1. "Start / Stop" button on housing
- 2. Remote control (may be separately ordered)
- Computer controllable, by realization of the key function start / stop with help of a suitable hardware (not available at the MF GmbH)

The start pulse at X3/6-7 (pulse length is approx. 100ms) starts the upper measuring head (with measuring direction upwards), it moves downwards.

When the upper measuring head reaches the lower one, it pushes it down until it reaches the adjustable stop.

Now the measuring arms are closed. After the attachment to the sample, the positioning motor is switched off and an internal contact K1 of the MFE is closed.

Via X3/8 and X3/9, this contact K1 can be evaluated and the start of the measuring process can thus be initiated. The stop pulse via X3/4-5 (pulse length approx. 100ms) causes the arms of the MFE to open immediately.

After opening the measuring arms, the upper measuring head moves back down to the starting position. When the initial position is reached, the positioning motor is switched off again and contact K1 is opened.

Measuring signal

Rotary encoders are used to record the change in length. Each measuring head actuates one of them.

The measuring signal is supplied by connector X1 resp. X2. The sinusoidal incremental signals A and B are electrically phase-shifted by 90° and have a signal level of typically 1 Vpp. The output signals of the two encoders must be processed separately at first, then the difference is calculated. The resolution can be less than 1 μ m depending on the interpolation and counting method.


Counter cards, measuring amplifiers and cables are not included in the scope of delivery of the MFE!

Meaning of the LEDs

| LED 1 | green | MFE ready for operation | | |
|-------|--------|-------------------------|--|--|
| LED 2 | yellow | Upper head moves | | |
| | red | Command open arms | | |
| LED 3 | green | Command close arms | | |
| LED 4 | | Measuring arms opening | | |
| LED 5 | green | Measuring arms closing | | |
| | | | | |

Delivery scope

| 1 | MFE |
|---|------------------------------------|
| 2 | Gauge head |
| 1 | Mounting plate |
| 1 | Power supply 24 V, 3-pin connector |
| 2 | D-Sub-Plug (female) 15-pol. X1/X2 |
| 1 | D-Sub-Plug (male) 15-pol. X3 |
| 1 | 3 mm hexagon screwdriver |
| 1 | Screwdriver TORX T10 |
| 1 | Test report |

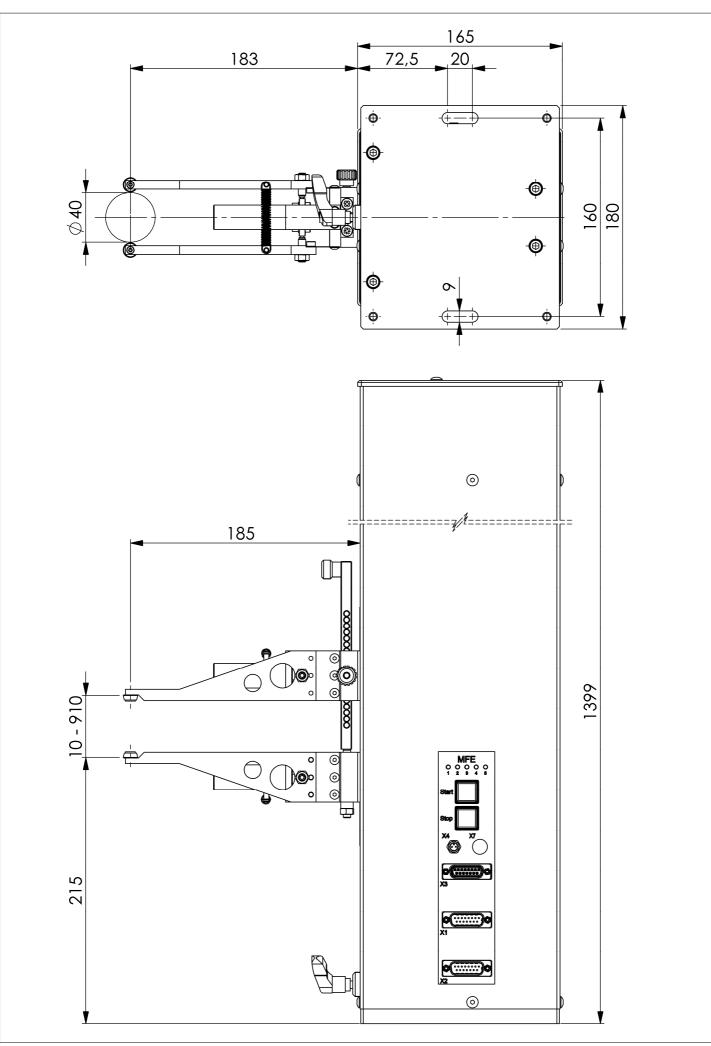


Drawing 1: MFE 900 dimensions


Installing


Observe the following points to remove the transport lock:

 - 1. Place the unit upright.
- 2. Unscrew the two setscrews (5) on the back of the unit with a 3mm hexagon screwdriver and add them to the accessories.
- 3. Release the stop (6) with the lever (7) (frontside) and move it downwards.
- 4. Mounting the measuring heads:
 - a. Connect the measuring heads in the proper position.
 - b. Spread the pair of measuring arms with the index finger and thumb of the left hand and, at the same time, insert and tighten the two supplied socket head screws M4x12 (DIN 912) with the enclosed 3mm hexagon screwdriver with the right hand.




- 1. Set the gauge length of 10 mm on the GL-scale (1) (detailed view A).
- 2. Unscrew and remove both measuring heads (Attention! Carriages move upwars on their own).
- 3. Push the stop (6) upwards, fix it against the carriages without slack and clamp it with the lever (7)
- 4. Insert the two M6 setscrews at the back of the unit and tighten them carefully.

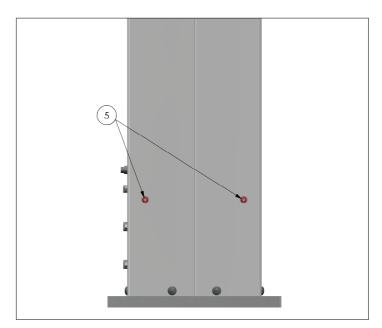


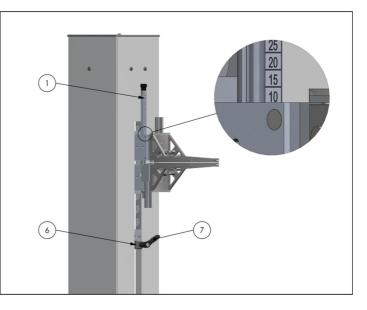

Attention!

It is essential to align the MFE900 vertically with a spirit level when setting it up and attaching it to the testing machine! This is necessary to ensure that the balance weights hang absolutely freely and the measuring heads move smoothly.

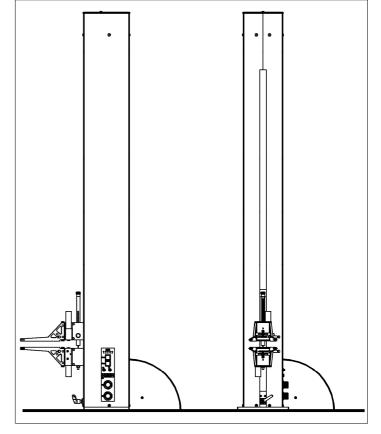

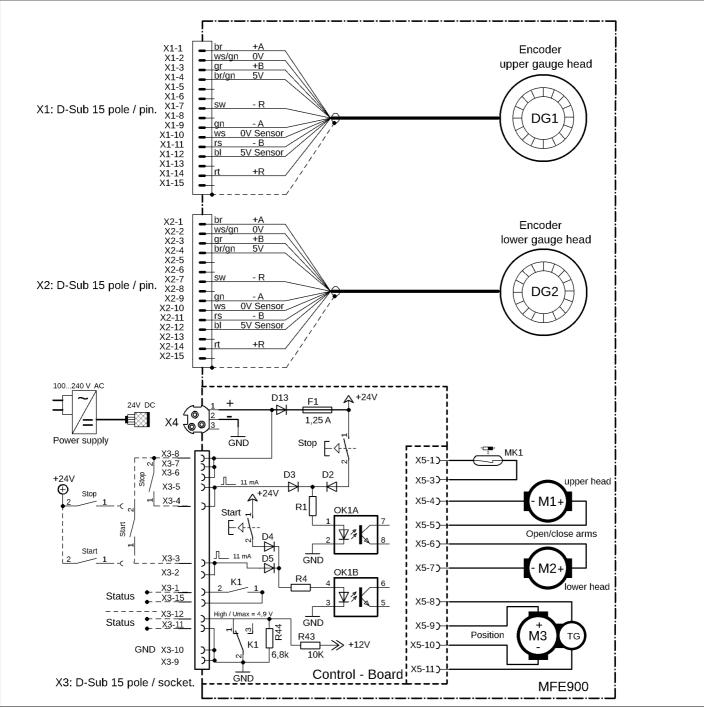

Drawing 2: MFE 900 block diagram

| PIN | X1 / X2 | X3 | X4 |
|-----|---------------------|-----------------------------------|---------------|
| 1 | +A / BN | Status / Measuring mode "on" | +24 V |
| 2 | 0 V / WH-GN | Start-Impuls (+UB) | GND |
| 3 | +B / GY | | |
| 4 | 5 V / BN - GN | Stop-Impuls (+UB) | |
| 5 | free | | |
| 6 | free | | |
| 7 | –R / BK | +UB of the MFE | |
| 8 | free | | |
| 9 | –A / GN | | |
| 10 | 0 V Sensor / WH | GND of the MFE | |
| 11 | -B / PK | | |
| 12 | 5 V Sensor / BU | Status 4.9V / Measuring mode "on" | |
| 13 | free | free | |
| 14 | +R / RD | | |
| 15 | free | Status / Measuring mode "on" | |
| TYP | D-Sub pin connector | D-Sub assembly socket; | Binder round |
| | 15-pole | 15-pole | connector, |
| | | | female 3 pole |

| Technical data | MFE 900 |
|--------------------------------------|--|
| Accuracy class according EN ISO 9513 | 2 till 1 mm travel |
| | 1 from 1 mm travel |
| Measuring system 1 (X1+X2) | Optical-incremental 1 Vpp (TTL optional) |
| Measuring travel | 900 mm minus gauge length |
| Signal period | 100 µm |
| Resolution | ≤1 µm (Depending on interpolation) |
| Accuracy | ±3 µm |
| Initial gauge lengths | 10 till 100 mm in 5 mm steps |
| Activating force | max. 10 cN |
| Clamping force | 150 cN |
| Opening width (between knife edges) | circa 40 mm |
| Weight | 32 kg |

 $\begin{array}{c} \hline \textbf{Device option} \\ \hline \textbf{Measuring system 1 with TTL} - \textbf{Measuring output} \\ \textbf{and 1 } \mu \textbf{m} \text{ resolution (with a 4-fold counting)} \end{array}$